

YORK

Survey Supply



Nothing else measures up!

Follow us!

- York Survey Supply Centre
- @York_Survey
- @York_Survey

Prospect House
George Cayley Drive
Clifton Moor
York
England
YO30 4XE

Tel: +44 (0) 1904 692723
Fax: +44 (0) 1904 690385

E-Mail: sales@yorksuey.co.uk

 **YorkSurvey**.co.uk
...for secure online ordering of all our products!

YORK

Survey Supply

Manual Ranging Digital Multimeter



Operating Instructions

Digital-Multimeter

OPERATION MANUAL

LINRODUCTION

This instrument is compact,rugged, battery operated, handheld 3 1/2 digit digital multimeter for measuring DC and AC voltage,DC and AC current, Resistance and Diode, Capacitance, Transistor,continuity Test and temperature or frequency.

The Dual-slope A-D Converter uses CMOS technology for auto-zeroing, polarity selection and overrange indication. Full overload protection is provided. It is an ideal instrument for use in the field, laboratory, workshop, hobby and home applications.

2.FEATURES

- Push-button ON-OFF power switch.
- Simple 30 position easy to use rotary switch for FUNCTION and RANGE selection.
- High sensitivity of 100µV.
- Automatic over range indication with the "1" displayed.
- Automatic polarity indication on DC ranges.
- All ranges fully protected.
- Resistance measurements 0.1Ω to 20MΩ.
- Capacitance measurements 1pF to 20pF.
- Diode testing with 1mA fixed current.
- Transistor hFE Test With Ib=100µA.
- Temperature measurement with or without K type thermocouple.

3.SPECIFICATIONS

Accuracy: see ± (% reading + No. of digits)

Guaranteed for 1 year, 23°C±5°C, less than 75% RH.

DC Voltage

RANGE	ACCURACY		RESOLUTION
	3 1/2	4 1/2	
20mV	±(1.2%reading + 3 digits)	±(1.2%reading + 15 digits)	0.1mV
2V	±0.5% of rdg ± 2 digits	±0.1% of rdg ± 2 digits	1mV
20V			10mV
200V			100mV
2000V	±0.8% of rdg ± 2 digits	±0.2% of rdg ± 5 digits	1V

*The resolution rate of 4 1/2 shall be a level higher.

Input Impedance:10M ohm on all ranges.

Overload Protection:1000V dc. Or peak ac on all ranges.

AC Voltage

RANGE	ACCURACY		RESOLUTION
	3 1/2	4 1/2	
20mV	±(1.2%reading + 3 digits)	±(1.2%reading + 15 digits)	0.1mV
2V			1mV
20V	±(1.2%reading + 3 digits)	±(1.2%reading + 15 digits)	10mV
200V			100mV
2000V	±(1.2%reading + 3 digits)	±(1.2%reading + 15 digits)	1V

*The resolution rate of 4 1/2 shall be a level higher.

Input Impedance:10M ohm on all ranges.

Frequency Range:40Hz to 400Hz.

Overload Protection:750V rms or 1000V peak common on ac ranges,except 200mV ac range(15 seconds maximum above 300V rms).

Indication:Averaging of sine wave.

DC Current

RANGE	ACCURACY		RESOLUTION
	3 1/2	4 1/2	
20µA	-----	-----	10nA
200µA	±(0.8%reading + 2 digits)	-----	10nA
2mA	-----	±(0.8%reading + 2 digits)	1µA
20mA	-----	-----	10µA
200mA	±(0.2%reading + 2 digits)	±(0.2%reading + 2 digits)	100µA
2A	-----	-----	1mA
20A	-----	-----	10mA
200A	±(2%reading + 5 digits)	±(2%reading + 10 digits)	10mA

*The resolution rate of 4 1/2 shall be a level higher.

Overload protection:0.2A / 250V AC,20A range not fused.

Maximum Input Current:20A, 15 sec.

AC Current

RANGE	ACCURACY		RESOLUTION
	3 1/2	4 1/2	
20µA	±(0.8%reading + 7 digits)	-----	10nA
200µA	±(1.8%reading + 3 digits)	-----	10nA
2mA	±(1.8%reading + 3 digits)	±(1.8%reading + 10 digits)	1µA
20mA	-----	-----	10µA
200mA	±(1.8%reading + 3 digits)	±(1.8%reading + 10 digits)	100µA
2A	-----	-----	1mA
20A	-----	-----	10mA
200A	±(2%reading + 7 digits)	±(2%reading + 10 digits)	10mA

* The resolution rate of 4 1/2 shall be a level higher.

Overload Protection:0.2A / 250V rms,(20A range not fused)

Frequency Range:40Hz to 400Hz

Maximum Input Current:20A, 15 sec.

Indication:Averaging of sine wave

Temperature for guaranteed accuracy: 23°C to ±5°C

Temperature Range: Operating 0°C to 40°C, 32°F to 104°F, Storage:-10°C to 50°C, 14°F to 122°F.

Power Supply: One 9-volt battery (NiCd 1044 4F22TYPE or equivalent)

Low Battery Indication: to left of display.

Size: 85W x 170D x 35Hm.

Weight: 340g(including 9-volt batteries).

Accessories: Operating manual, Set of test leads.

Optional Accessories: Thermocouple (K type, 400°C),Spice fuse(200mA/250V fast blow type), 9V Battery (Zinc-Carbon type), Soft Carrying case.

5.OPERATION

1.Check the 9-volt battery by setting the ON-OFF switch to ON. If the battery is weak, a sign will appear on the display.

If this does not appear on the display, proceed as below. See MAINTENANCE if the battery has to be replaced.

2.The meter, or sign near to the test lead jacks, is for warning that the input voltage or current should not exceed the indicated values.

This is to prevent damage to the internal circuitry.

3.The function switch should be set to the range which you want to test before operation.

4.If the voltage or current range is not known beforehand, set the FUNCTION switch to a high range and work down.

5.When only the figure "1" is displayed, overrange is being indicated and the FUNCTION switch must be set to a higher range.

5.1)DC Voltage Measurement

1. Connect the BLACK test lead to the COM jack and the RED test lead to the VΩ jack.

2. Set the FUNCTION switch to the V-range to be used and connect the test leads across the source or load under measurement.

The polarity of the RED lead connection will be indicated at the same time as the voltage.

Note:

Do not apply more than 1000V to the input,indication is possible at higher voltages but there is danger of damaging the internal circuitry.

5.2)AC Voltage Measurement

1. Connect the BLACK test lead to the COM jack and the RED test lead to the VΩ jack.

2. Set the FUNCTION switch to the V-range to be used and connect the test leads across the source or load under measurement.

Note:

Do not apply more than 700V rms to the input,indication is possible at higher voltages but there is danger of damaging the internal circuitry.

5.3)DC Current Measurement

1. Connect the BLACK test lead to the COM jack and the RED test lead to the mA jack for a Maximum of 20mA. For a maximum of 20A, move the red test lead to the 20A jack.

2. Set the FUNCTION switch to the A-range to be used and connect the test leads in series with the load under measurement. The polarity at the RED test leads in series with the load under measurement. The polarity at the RED test lead connection will be indicated at the same time as the current.

Note:

The Maximum input current is 200mA, or 20A depending upon the jack used. Excessive current will blow the fuse which must be replaced.The 20A range is not protected by a fuse.The fuse rating should be 200mA.

And no more to prevent damage to the internal circuitry.

The Maximum terminal voltage drop is 200mV.

5.4)AC Current Measurement

1. Connect the BLACK test lead to the COM jack and the RED test lead to the mA jack for a maximum of 200mA.

For a maximum of 200 mA, move the RED test lead to the 20A jack.

2. Set the FUNCTION switch to the A-range to be used and connect the test lead in series with the load under measurement.

Note:

The Maximum input current is 200 mA, or 20A depending upon the jack used.Excessive current will blow the fuse which must be replaced.The 20A Range is not protected by a fuse.The fuse rating should be 200 mA and no more to prevent damage to the internal circuitry. The maximum terminal voltage drop is 200 mV.

5.5)Resistance Measurement

1. Connect the BLACK test lead to the COM jack and the RED test lead to the VΩ jack.(Note:The polarity of the RED test lead is "+")

2. Set the FUNCTION switch to the Ω range to be used and connect the test leads across the resistance under measurement.

Note:

1. If the resistance value being measured exceeds the maximum value of the range selected an over-range indicator will be displayed("1").Select a higher range. For resistance of approximately 1 megohm and above, the Meter may take a few seconds to become stable. This is normal for high resistance readings.

2. When the input is not connected, i.e. at open circuit, the figure "1" will be displayed for the overrange condition.

3. When checking in-circuit resistance, be sure the circuit under test has all power removed and that all capacitors are fully discharged.

4. 200MΩ Ω range open circuit voltage is 3V. Display reading is 10 digits when test leads short, this is normal when measure 10MΩ resistor on 200MΩ Ω range.Display reading is 20, measure 100MΩ resistor on 200MΩ Ω range,display reading is 110. The 10 digits is a constant and should be subtracted from the reading.

5.6)Capacitance Measurements

1. Before connecting the test capacitor, note the display which may have reading other than zero each time the ranges is changed.This offset reading will not affect the accuracy for it can be overdriven by true value.

2. Connect the test capacitor to the input socket(not test leads)noting the polarity connections when required.

Note:

When two individual capacitor, insert the leads into the two sockets with "+" (upper socket), "-" (Lower socket)at the left of the panel.Capacitors should be discharged before being inserted into the test jack.

2. When using polarized capacitors,for example the maximum type,particular attention must be paid to the polarity connections.This is to prevent possible damage to the capacitor.

When testing large capacitance, note that there will be a certain time lag before the final indication.

Do not connect an external voltage, or a charged capacitor(expecially larger capacitors) to the measuring terminals.

5.7)Diode Measurement and Continuity Test

1. Connect the BLACK test lead to the COM jack and the RED test lead to the VΩ jack.(Note:The polarity of the RED test lead is "+")

2. Set the FUNCTION switch to the range and connect the test leads across the diode under measurement, display shows the approx forward voltage of this diode.

3. Connect the test leads to two points of circuit if the resistance is lower than approx 30Ω,buzzer sounds.

5.8)Transistor Test

1. Set the FUNCTION switch to the I_{FE} range.

2. Determine whether the transistor is NPN or PNP and locate the Emitter,Base and collector leads from the leads into the proper hole in the socket on the front panel.

3. The display will read the approximate h_{FE}value at the test condition Base Current:10uA,VCE:2.8V.

5.9)Temperature Measurement

1. Measure temperature with K type thermocouple. Set the FUNCTION switch to the T range and insert the K type thermocouple plug into K PROBE socket.

2. Measure ambient temperature without probe; On the same T range, display reading is the ambient temperature is +2°C.

5.10)Frequency Test

1. Connect test leads or shield cable to COM and F/VΩ jack.

2. Set the FUNCTION switch to kHz range, and connect test leads or cable across the source or load under measurement.

Note:

Do not apply more than 220V rms to the input, indication is possible at voltage higher than 10Vrms, but readings may be out of specification.

2. In noisy environment, it is preferable to use shield cable for measuring small signal.

5.11)Auto Power-off(Optional Function)

Automatic Power-off extends the life of the battery by turning the meter off if no rotary function switch is operated for about 15 min.The meter turns back on if either the rotary switch is turned or the power switch is pressed again.

6.MAINTENANCE

Battery and/or fuse replacement should only be done after the test leads have been disconnected and POWER OFF.

6.1)9-Volt Battery Replacement

Note the condition of the 9-volt battery using the procedure described above, if the battery needs to be replaced,open the back cover remove the spent battery and replace it with a battery of the same type.

6.2)Fuse Replacement

Should the fuse need replacement use only 200mA fuses identical in physical size to the original.